



ISSN: 2350-0328

**International Journal of Advanced Research in Science,  
Engineering and Technology**

**Vol. 4, Issue 4 , April 2017**

# **Study And Empirical Modeling Relating Welding Parameters And Tensile Strength of Hot Air Welded Polypropylene Plastic**

**Sandeep Kumar Gupta, AnuragShrivastava, MahmoodAlam**

P.G Student, Department of Mechanical Engineering, SRIMT, Lucknow, India

Assistant Professor, Department of Mechanical Engineering SRIMT, Lucknow, India

Assistant Professor, Department of Mechanical Engineering, Integral University, Lucknow, India

**ABSTRACT:** The goal of the work is to investigate the effect of some input parameters on the desired responses in the Polypropylene plastic welding by hot air welding technique. The effect of welding current, welding speed and mass flow rate of hot air has been evaluated on the Tensile Strength, of the butt weld bead deposited. These responses have been analyzed using the analysis of variance (ANOVA) and empirical modeling. Plots of significant factors and empirical modeling have been used to determine the best fit relationship between the responses and the model parameters using MINITAB 15. This has been used to determine which is the most influencing factor or parameter. A confidence level of 95% has been used for the analysis. The weld tensile strength has been found to increase with increase of welding current and welding speed

**KEYWORDS:** Welding of Polypropylene (PP) plastic, Hot air welding, Empirical Modeling, and tensile strength of Polypropylene plastic, ANOVA technique.

## **I. INTRODUCTION**

Plastics have excellent strength to weight ratio, good corrosion resistance and ability to take good surface finish. Plastics can be categorized as thermo sets and thermoplastics. Among these two only the thermoplastics weldable. In case of thermo sets resins, a chemical reaction occurs during processing and curing, that is, as a result of irreversible cross-linking reaction in the mold [2]. There are many ways to weld plastic such as hot plate, friction, vibration, hot gas and ultrasonic. Hot gas (air) welding is one of the external heating methods [1, 3, 5, 6] and it was patented by Reinhardt in 1940 [4]. He reported that weld groove and weld rod were heated with hot air stream until they soften sufficiently to fuse, then the welding rod is pressed into the groove. During welding, weld strength is reduced by high consumption of antioxidant and thermo oxidative decomposition of the polymer molecules [7]

## **II. DESIGN OF EXPERIMENT AND EXPERIMENTAL WORK**

The design of experiment is based on  $2^n$  factorial design which is known as full factorial technique. Here  $n$  is number of variables taken during the experiment [8]. In my experiment  $n = 3$ . A full factorial design contains all possible combinations of a set of factors. This is the most fool proof design approach, but it is also the most costly in experimental resources. The full factorial designer supports both continuous factors and categorical factors with up to nine levels. In full factorial designs, an experimental run at every combination of the factor levels.

If there are  $n$  factors that we need to evaluate in a process we need to run the experiment  $2^n$  times. Each factor will have two levels, a "high" and "low" level. Table 1 shows the factorial design in a standard order matrix.

The  $2^3$  factorial design has two levels of each of the three variables requires  $2 \times 2 \times 2 = 8$  run. The  $2^3$  design matrix is shown in Table 1 design matrix is shown in Table

**TABLE 1 MATRIX PREPARED FOR INPUT VARIABLES AND CORRESPONDING RESPONSES**

	X <sub>1</sub>	X <sub>2</sub>	X <sub>3</sub>	Responses
S.NO.	I Ampere	S mm/sec	Q mm <sup>3</sup> /sec	T Strength (N/mm <sup>2</sup> )
1	low	low	low	
2	low	low	high	
3	low	high	low	
4	low	high	high	
5	high	low	low	
6	high	low	high	
7	high	high	low	
8	high	high	high	

“High” indicates the maximum value of input parameter

“Low” indicates the minimum value of input parameter

Where X<sub>1</sub>= Input current in ampere

X<sub>2</sub>= Welding speed in mm/second

X<sub>3</sub>= Mass flow rate of hot air in mm<sup>3</sup>/sec

A total of 8 experiments have been conducted using 3 different parameter. The combination of input parameter is taken on the basis of full factorial technique. Three parameter have been taken as current, weld speed and mass flow rate of the hot air. Detail description of input parameter is given below:

**A. INPUT PARAMETERS TAKEN IN EXPERIMENT**

**Welding Current (I)**

Maximum Current (I<sub>max</sub>) = 1.7 ampere

Minimum Current (I<sub>min</sub>) = 1.3 ampere

**Mass flow rate of hot air (Q)**

Cross-section area of the nozzle= 22.06 mm<sup>2</sup>

Minimum velocity of hot air (V<sub>min</sub>) = 0.2 m/sec= 200 mm/sec

Maximum velocity of hot air (V<sub>max</sub>) = 0.8 m/sec= 800 mm/sec

Therefore, Maximum mass flow rate (Q<sub>max</sub>) = A \* V<sub>max</sub> = 22.06 \* 800 = 17648 mm<sup>3</sup>/sec

$$Q_{max} = 17648 \text{ mm}^3/\text{sec}$$

Similarly, Minimum mass flow rate (Q<sub>min</sub>) = A \* V<sub>min</sub> = 22.06 \* 200 = 4412 mm<sup>3</sup>/sec

$$Q_{min} = 4412 \text{ mm}^3/\text{sec}$$

**Welding Speed (S)**

$$\text{Maximum welding speed (S}_{max}) = \frac{\text{Distancetravel}}{\text{timetakentocoverthedistance}}$$

Distance travel = width of the work piece= 6 cm= 60 mm

Maximum time taken to travel the distance= 46 seconds

Minimum time taken to travel the distance= 29 seconds

Therefore, maximum welding speed (S<sub>max</sub>)

$$= \frac{\text{Distancetravel}}{\text{Minimumtimetakentotravelthedistance}} = \frac{60}{29} = 2.068 \text{ mm/sec}$$

$$S_{max} = 2.068 \text{ mm/sec}$$

$$\text{Similarly, minimum welding speed (S}_{min}) = \frac{\text{Distancetra vel}}{\text{Maximumtimetakentotravelthedistance}} = \frac{60}{46} = 1.304 \text{ mm/sec}$$

$$S_{min} = 1.304 \text{ mm/sec}$$

Weld beads obtained at different combination of welding parameter are shown below:



Figure 1 Weld bead formed in 1 to 8<sup>th</sup> experiment

### III. TESTING OF WELDED WORK PIECE

Tests have been being conducted on tensile testing machine. Range of the load is up to 500 kgf or 4905 Newton. When gradual load (tensile) is applied to the work piece, work piece suffered a little deflection before fracture

TABLE 2 STRENGTH AT DIFFERENT VALUES OF INPUT PARAMETERS

S.No	Current(I) In ampere	Weld speed (S)in mm/sec	Mass flow rate(Q) in mm <sup>3</sup> /sec	Deflection (Δl)in mm	Ultimate load(W) in kgf	Ultimate load(W) in Newton	Strength= $\frac{\text{Ultimate load}}{\text{Cross-section area}}$ (N/mm <sup>2</sup> )
1.	1.3	1.30	4412	2.3	97.85	97.85×9.81=959.90	959.90/300= 3.2
2.	1.3	1.30	17648	1.4	105.5	105.5×9.81=1034.9	1034.95/300= 3.44
3.	1.3	2.07	4412	1.2	100	100×9.81= 981	981/300= 3.27
4.	1.3	2.07	17648	1.7	79.51	79.51×9.81= 779.99	779.99/300= 2.60
5.	1.7	1.30	4412	1.1	115.4	115.4×9.81= 1132.04	1132.07/300= 3.77
6.	1.7	1.30	17648	0.9	110.11	110.11×9.81= 1373.4	1080.08/300= 3.60
7.	1.7	2.07	4412	1.5	140	140×9.81= 1373.4	1373.4/300= 4.57
8.	1.7	2.07	17648	0.8	80.4	788.72×9.81=788.72	788.724/300= 2.62

### IV. EMPIRICAL MODELING

Regression analysis is used to establish relationship between two variables. The response variable y is independent variable or variable of interest, and the predictor variable x is the dependent variable. An objective of regression analysis is to develop a regression model, relation y to x that can be used to predict values of the response variable. As in case of simple linear regression model relation y to x is

$$Y = B_0 + B_1 X_1 + \epsilon \quad .1$$

Where,  $B_0$  = y-intercept, and  $B_1$  = slope of the line.  $B_0$  is the mean value of y when x is zero.  $B_1$  is the change in the mean value of y for one unit change in x and  $\epsilon$  is the random error.



**A REGRESSION ANALYSIS FOR TENSILE STRENGTH OF THE OBTAINED WELD BEAD**

Equation 2 is the regression equation obtained from regression analysis. ANOVA for the regression has been given in table 3. Regression table also suggests that welding speed is most significant factor. Table 3 indicates that p value for regression equation is significant. The regression equation is –

$$\text{Tensile strength (T)} = T = 2.51 + 1.28 I - 0.308 S - 0.000048 Q \dots\dots\dots (2)$$

Where I = Current

S = Welding speed

Q = Mass flow rate of hot air

**TABLE.3 REGRESSION TABLE FOR TENSILE STRENGTH OF WELD BEAD**

Predictor	Coef	SE Coef	T	P
Constant	2.513	1.861	1.35	0.248
I	1.281	1.046	1.23	0.288
S	-0.3084	0.5432	-0.57	0.601
Q	-0.00004816	0.00003160	-1.52	0.202

S = 0.591534 R-Sq = 50.9% R-Sq(adj) = 14.1%

**TABLE. 4 ANALYSIS OF VARIANCE TABLE FOR TENSILE STRENGTH OF WELD BEAD**

Source	DF	SS	MS	F	P
Regression	3	1.4509	0.4836	1.38	0.369
Residual Error	4	0.3499	1.3996		
Total	7	2.8506			

**B.RESIDUAL ANALYSIS FOR TENSILE STRENGTH**

Residual is the difference between the observed and fitted value of the response. Four different plots have been drawn for residual analysis for tensile strength:

- (a) Normal probability plot( residual Vs percent variation in tensile strength)
- (b) Residual Vs frequency histogram.
- (c) Residual Vs fitted value.
- (d) Residual Vs observation order. (see figure 2, 3, 4, and 5)

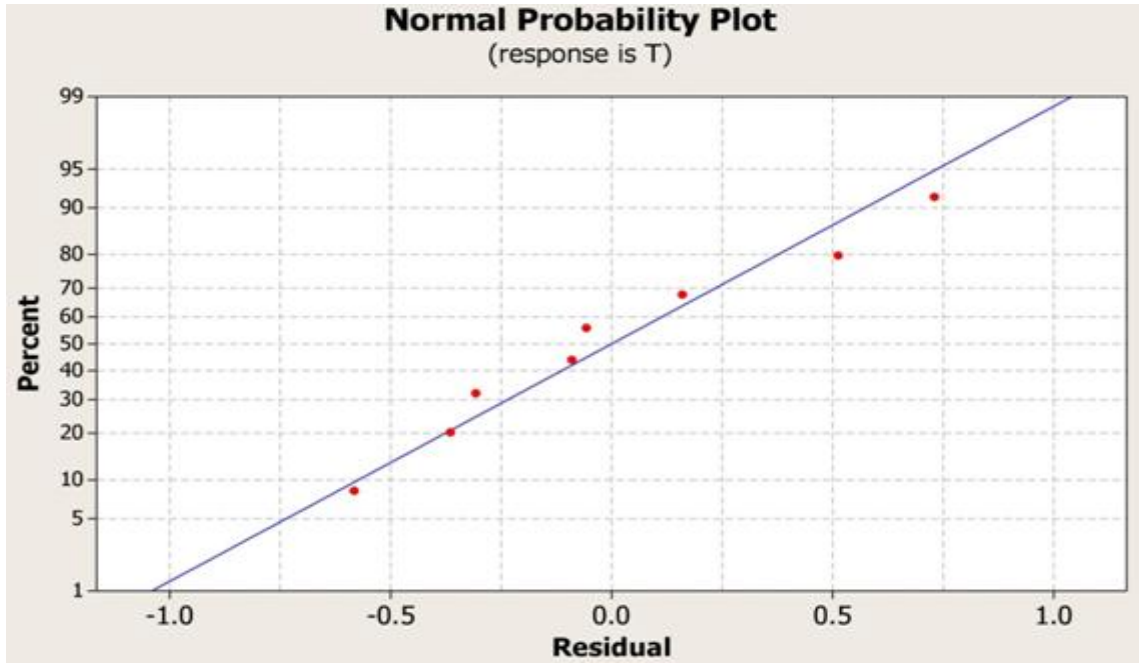


Figure 2 Normal probability plots for Tensile Strength of weld bead

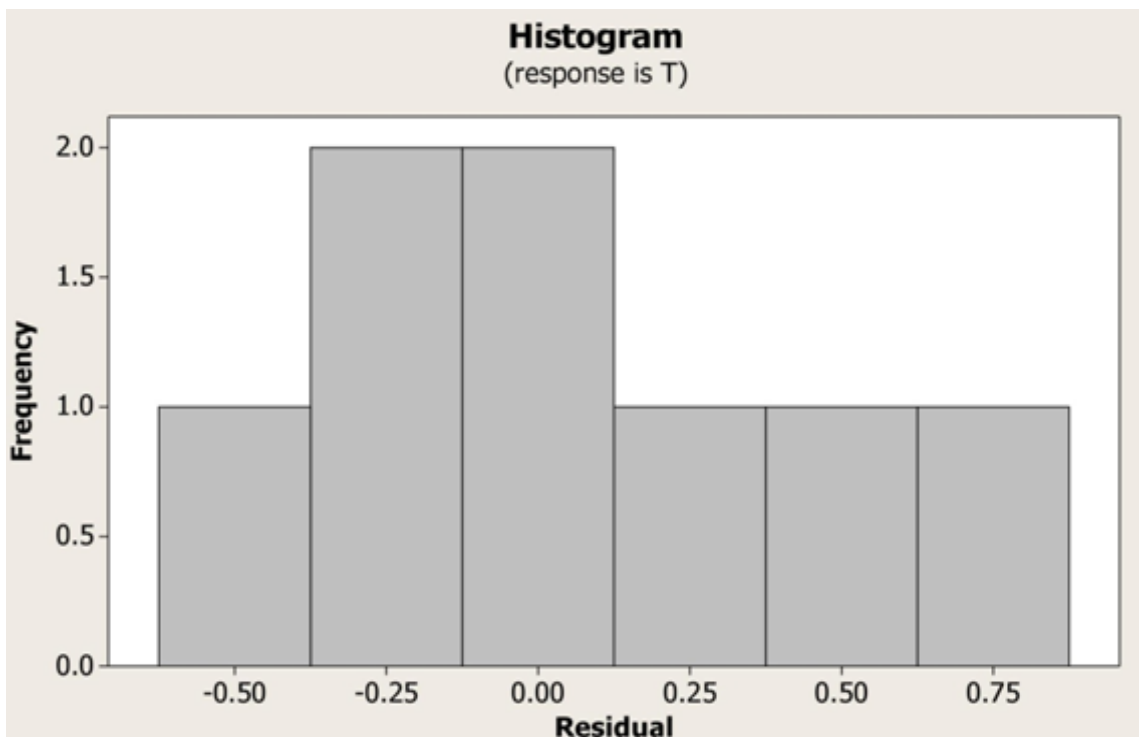


Figure 3 Histogram for Tensile Strength of weld bead

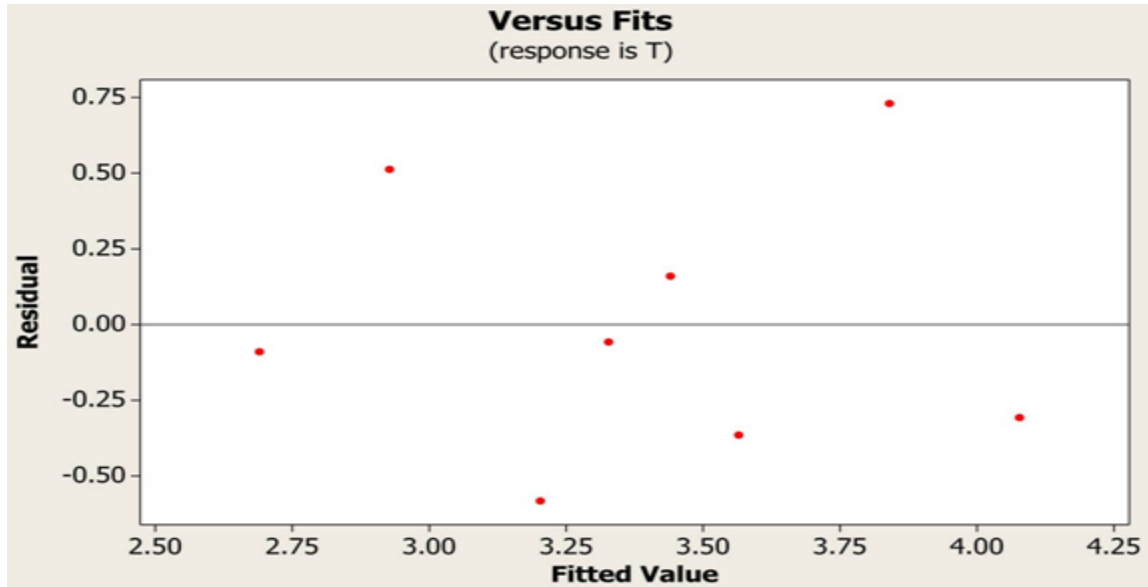


Figure 4 Versus fits for Tensile Strength of weld bead

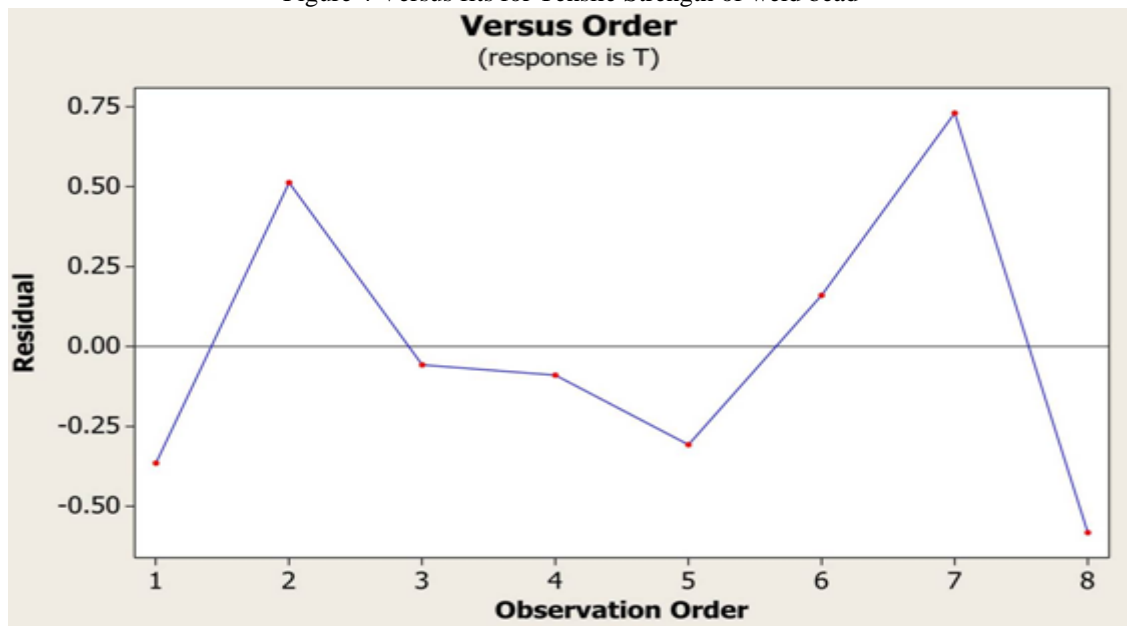


Figure 5 Versus order for Tensile Strength of weld bead

The x-axis of histogram plot indicates the residuals and y-axis indicates the frequency of occurrence of that residuals. The normal probability plot and histogram suggests approximate normal distribution of residuals. In residual plot of fits x-axis represent the tensile strength response and y-axis the residuals. Straight horizontal line residual versus fits shows the zero residual or the fitted model line which means all the points would have been lying on that if there is zero residual or no residual which is nearly not possible. The scattered points in residual versus fits show the residuals lying away from the fitted value. Absence of any particular trend of residuals in versus fitted value plot shows the good fit of the model.

## V.RESULTS AND DISCUSSION

The effect of input parameter was studied on tensile strength, of the butt weld bead by using Regression analysis and full factorial design. Tensile strength is measured as the response parameter. Regression analysis was completed for all

the responses to analyze the significance of the input factors. Regression equation was developed to predict the relationship amongst the dependent and independent variables.

**TABLE 5 SHOWS THE VALUES OF TENSILE STRENGTH OBSERVED AND PREDICTED.**


S.NO.	I Ampere	S mm/sec	Q mm <sup>3</sup> /sec	T (Observed) Strength (N/mm <sup>2</sup> )	T (predicted) Strength (N/mm <sup>2</sup> )
1	1.3	1.30	4412	3.2	3.56
2	1.3	1.30	17648	3.44	2.926
3	1.3	2.07	4412	3.27	3.27
4	1.3	2.07	17648	2.60	2.68
5	1.7	1.30	4412	3.77	2.16
6	1.7	1.30	17648	3.60	3.43
7	1.7	2.07	4412	4.57	3.83
8	1.7	2.07	17648	2.62	3.20

**A.RESULTS**

1. Weld current has been found to be a significant factor in regard to tensile strength with p value of 0.288 (table 3). Apart from weld current other significant factor is weld speed but it is lesser significant than weld current. The p value of speed is 0.601 (table 3). Mass flow rate did not show any significant impact on the tensile strength of the weld bead.

2. Maximum value of tensile strength can be calculated by the model developed as Tensile strength  
 $T = 2.51 + 1.28 I - 0.308 S - 0.000048 Q$

The maximum value of tensile strength predicted by above formula is **3.83664** which is shown in given Table 5 and obtained at higher level of weld current.

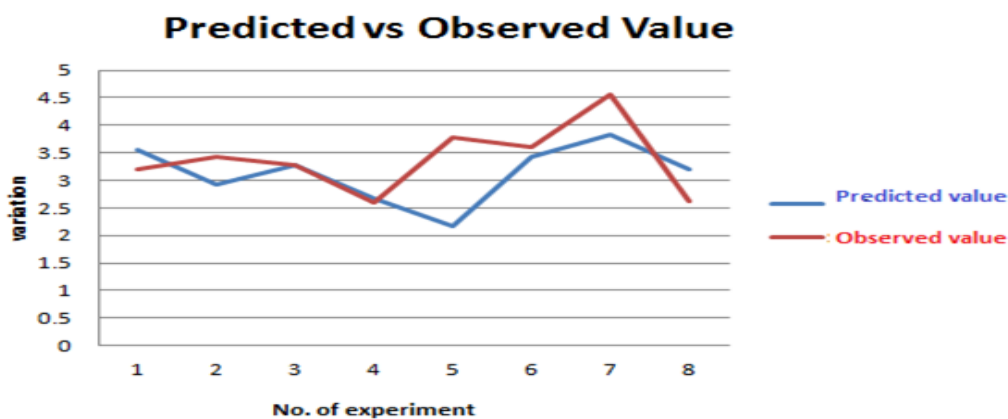

**Figure 6:** Graph showing Comparison between predicted and observed value of tensile strength

There is very small variation between predicted value and observed value of tensile strength, hence developed model is justified and suitable.

**VI. CONCLUSION**

The present work has been carried out to study the effect of input parameters on Tensile strength of butt welds, made of Polypropylene plastic using hot air technique. These parameters (Current, weld speed and mass flow rate of hot air) are



ISSN: 2350-0328

# International Journal of Advanced Research in Science, Engineering and Technology

Vol. 4, Issue 4 , April 2017

varied at two levels as higher level and lower level. From the above study conclusion is drawn that tensile strength of the weld bead is mainly affected by the weld current. Higher tensile strength can be achieved at higher current.

## REFERENCES

- [1] Balkan O.,DemirerH.,Yildirim H.07, AMME Journal of Achievements in Materials and Manufacturing Engineering 31(2008)
- [2] RojekM., StabikJ., MuziaG.,07AMME Journal of Achievements in Materials and Manufacturing Engineering07 (31)2010
- [3] Schwartz M.M.,joining of composite matrix materials, ASM International, chapter 2, 35-87 1994,
- [4] Reinhardt R.C.,U .S. patent 2, 22,545: Method of welding thermoplastic materials
- [5] MarczisB., CziganyT,PeriodicaPolytechnica ser. Mech. Eng,(46/2)117-126, 2002
- [6] Stokes,V.K..Joining methods for plastics and plastics composites,An overview, polymer engineering and science (29/19)1989, 1310-1324
- [7] SchmachtenbergE.,C. Tuchert, Long term properties of butt welded polypropylene, Macromolecular materials and Engineering (288/4) 2003, 291-300
- [8] Dr. Manish Goyal, computer based numerical and statistical techniques Luxmi publications (p) Ltd.